
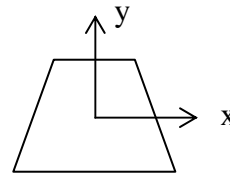


Beam Bending Stresses and Shear Stress

Pure Bending in Beams

With bending moments along the axis of the member only, a beam is said to be in pure bending.

Normal stresses due to bending can be found for homogeneous materials having a plane of symmetry in the y axis that follow Hooke's law.

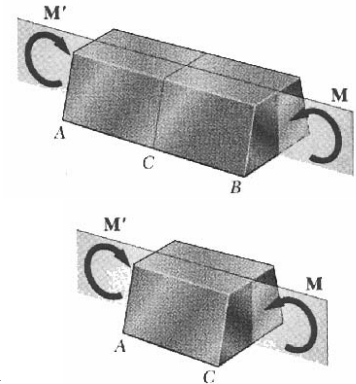

Maximum Moment and Stress Distribution

In a member of constant cross section, the maximum bending moment will govern the design of the section size when we know what kind of normal stress is caused by it.

For internal equilibrium to be maintained, the bending moment will be equal to the $\sum M$ from the normal stresses \times the areas \times the moment arms. Geometric fit helps solve this statically indeterminate problem:

1. The normal planes remain normal for pure bending.
2. There is no net internal axial force.
3. Stress varies linearly over cross section.
4. Zero stress exists at the centroid and the line of centroids is the *neutral axis* (n. a)


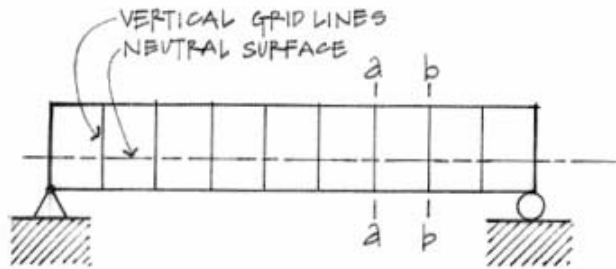


Figure 8.5(a) Beam elevation before loading.

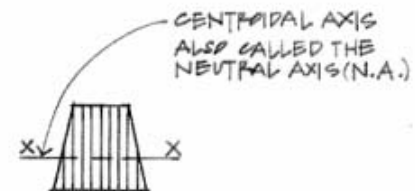

Beam cross section.

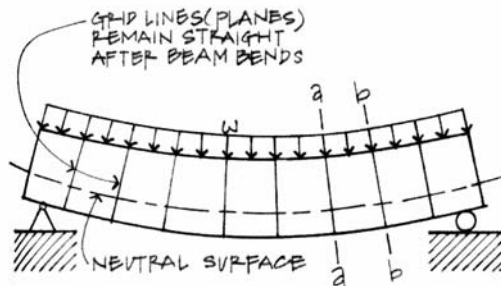


Figure 8.5(b) Beam bending under load.


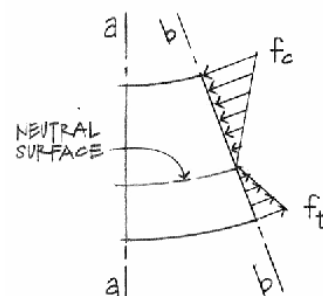


Figure 8.8 Bending stresses on section b-b.

Relations for Beam Geometry and Stress

Pure bending results in a circular arc deflection. R is the distance to the center of the arc; θ is the angle of the arc (radians); c is the distance from the n.a. to the *extreme fiber*; f_m is the maximum normal stress at the *extreme fiber*; y is a distance in y from the n.a.; M is the bending moment; I is the moment of inertia; S is the *section modulus*.

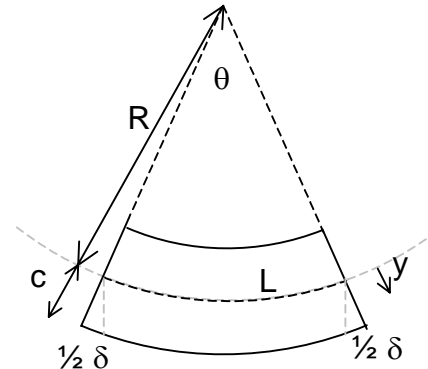

$$L = R\theta \quad \epsilon = \frac{\delta}{L} = R \quad f = E\epsilon = \frac{y}{c} f_{\max}$$

$$M = \sum f_i A_i \quad M = \frac{f_{\max}}{c} \sum y_i^2 A_i \quad I = \sum y^2 A \quad S = \frac{I}{c} \quad f_{\max} = \frac{Mc}{I} = \frac{M}{S}$$

Now: $f_b = \frac{My}{I}$ for a rectangle of height h and width b : $S = \frac{bh^3}{12 \cdot \frac{h}{2}} = \frac{bh^2}{6}$

RELATIONS:

$$\frac{1}{R} = \frac{M}{EI}$$

$$f_b = \frac{My^*}{I}$$

$$S = \frac{I}{c}$$

$$f_{b-\max} = \frac{Mc}{I} = \frac{M}{S}$$

$$S_{\text{required}} \geq \frac{M}{F_b}$$

*Note: y positive goes *DOWN*. With a positive M and y to the bottom fiber as positive, it results in a *TENSION* stress (we've called positive)


Transverse Loading in Beams

We are aware that transverse beam loadings result in internal shear and bending moments.

We designed sections based on bending stresses, since this stress dominates beam behavior.


There can be shear stresses *horizontally* within a beam member.

It can be shown that $f_{\text{horizontal}} = f_{\text{vertical}}$

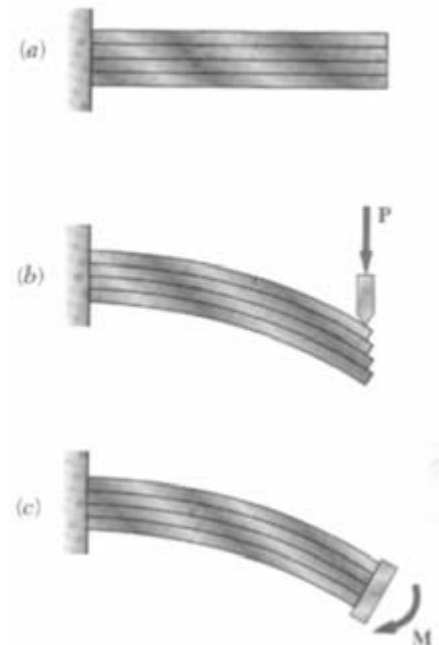

Equilibrium and Derivation

In order for equilibrium for any element CDD'C', there needs to be a horizontal force ΔH.

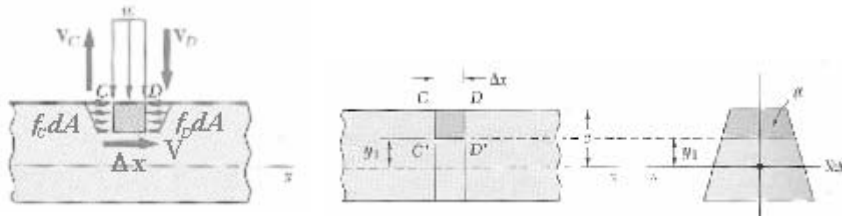

$$V = f_D dA - f_C dA$$

Q is a moment area with respect to the neutral axis of the area *above or below* the horizontal where the ΔH occurs.

Q is a maximum when y = 0 (at the _____).

$$V_{longitudinal} = \frac{V_T Q}{I} \Delta x$$

q is a horizontal shear per unit length → *shear flow*



$$q = \frac{V_{longitudinal}}{\Delta x} = \frac{V_T Q}{I}$$

Shearing Stresses

$f_{v-ave} = 0$ on the beam's surface. Even if Q is a maximum at y = 0, we don't know that the thickness is a *minimum* there.

$$f_v = \frac{V}{\Delta A} = \frac{V}{b \cdot \Delta x}$$

$$f_{v-ave} = \frac{VQ}{Ib}$$

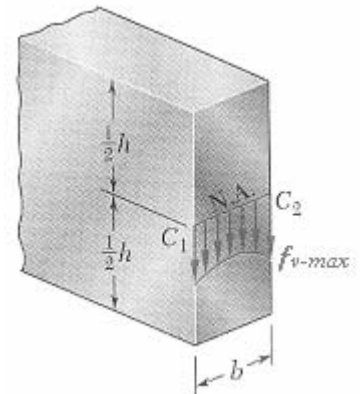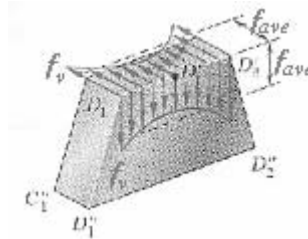

Rectangular Sections

f_{v-max} occurs at the neutral axis:

$$I = \frac{bh^3}{12} \quad Q = A\bar{y} = b \frac{h}{2} \cdot \frac{1}{2} \frac{h}{2} = \frac{bh^2}{8}$$

then:

$$f_v = \frac{VQ}{Ib} = \frac{V \frac{1}{8} bh^2}{\frac{1}{12} bh^3 b} = \frac{3V}{2bh}$$

$$f_v = \frac{3V}{2A}$$


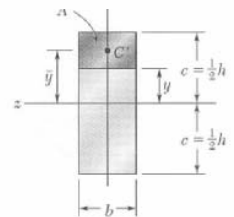


Fig. 6.15

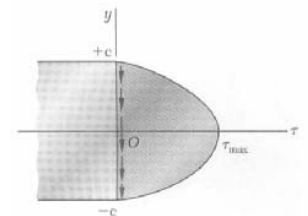


Webs of Beams



In steel W or S sections the thickness varies from the flange to the web.

We neglect the shear stress in the flanges and consider the shear stress in the web to be constant:

$$f_{v-max} = \frac{3V}{2A} \approx \frac{V}{A_{web}} \quad \boxed{f_{v-max} = \frac{V}{t_{web} d}}$$

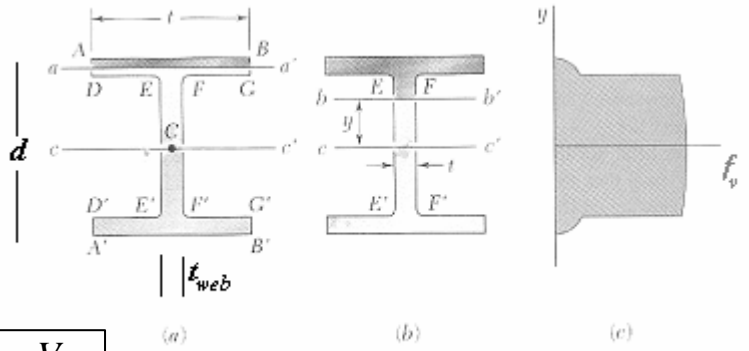


Webs of I beams can fail in tension shear across a panel with stiffeners or the web can buckle.

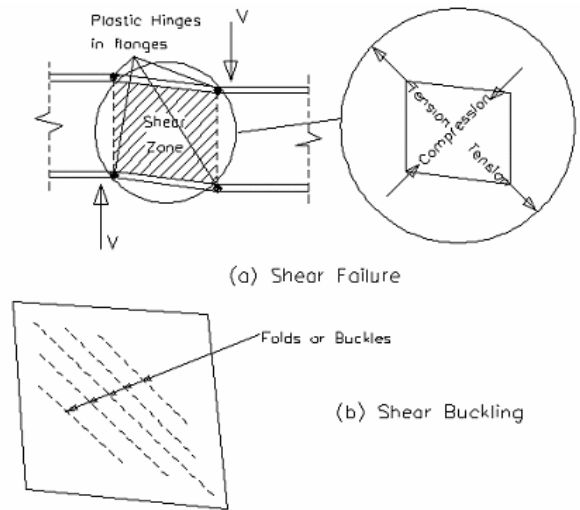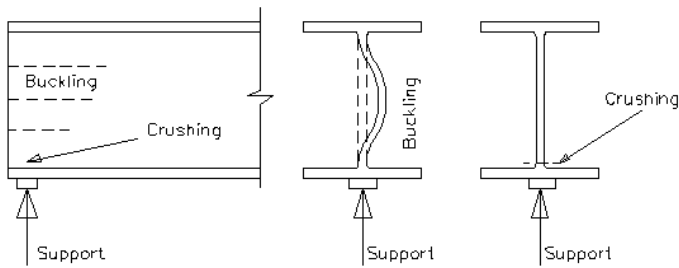


Shear Flow

Even if the cut we make to find Q is not horizontal, but arbitrary, we can still find the shear flow, q, as long as the loads on thin-walled sections are applied in a plane of symmetry, and the cut is made *perpendicular* to the surface of the member.

$$q = \frac{VQ}{I}$$

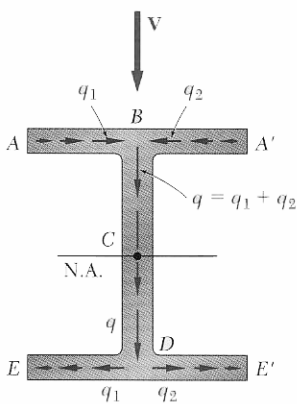


The shear flow magnitudes can be sketched by knowing Q.

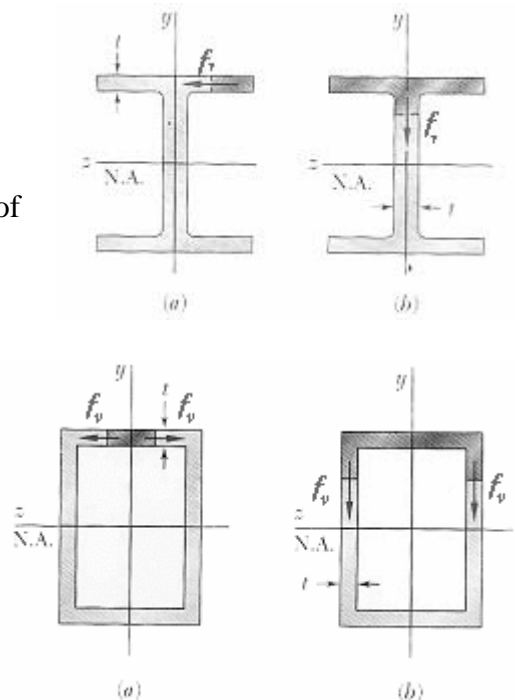

Connectors to Resist Horizontal Shear in Composite Members

Typical connections needing to resist shear are plates with nails or rivets or bolts in composite sections or splices.

The pitch (spacing) can be determined by the capacity in shear of the connector(s) to the shear flow over the spacing interval, p .

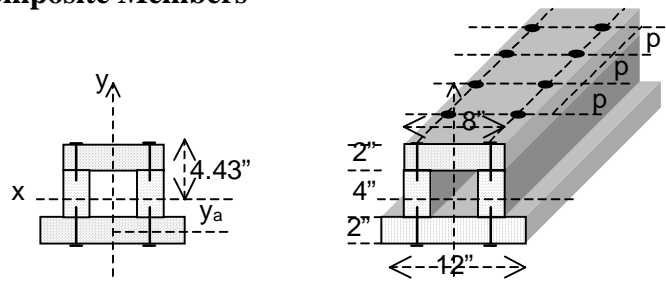

$$\frac{V_{longitudinal}}{p} = \frac{VQ}{I}$$

$$V_{longitudinal} = \frac{VQ}{I} \cdot p$$

where

$$nF_{connector} \geq \frac{VQ_{connected\ area}}{I} \cdot p$$

p = pitch length

n = number of connectors connecting the connected area to the rest of the cross section

F = force capacity in one connector

$Q_{connected\ area} = A_{connected\ area} \times y_{connected\ area}$


$y_{connected\ area}$ = distance from the centroid of the connected area to the neutral axis

Connectors to Resist Horizontal Shear in Composite Members

Even vertical connectors have shear flow across them.

The spacing can be determined by the capacity in shear of the connector(s) to the shear flow over the spacing interval, p .


$$p \leq \frac{nF_{connector} I}{VQ_{connected\ area}}$$

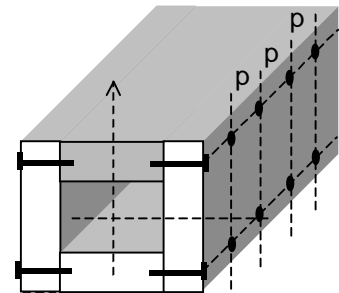

Unsymmetrical Sections or Shear

If the section is not symmetric, or has a shear not in that plane, the member can bend and twist.





If the load is applied at the *shear center* there will not be twisting. This is the location where the moment caused by shear flow = the moment of the shear force about the shear center.

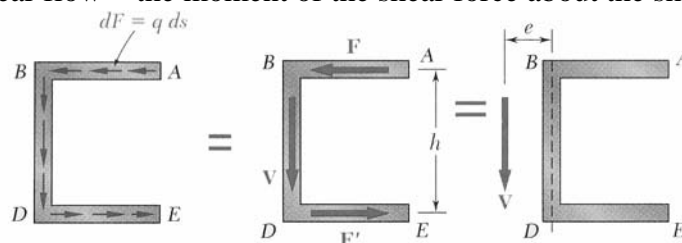

Example 1 (pg 303)

Example Problem 9.2 (Figures 9.15 to 9.18)

A beam must span a distance of 12' and carry a uniformly distributed load of 120 lb./ft. Determine which cross-section would be the least stressed: *a*, *b*, or *c*.

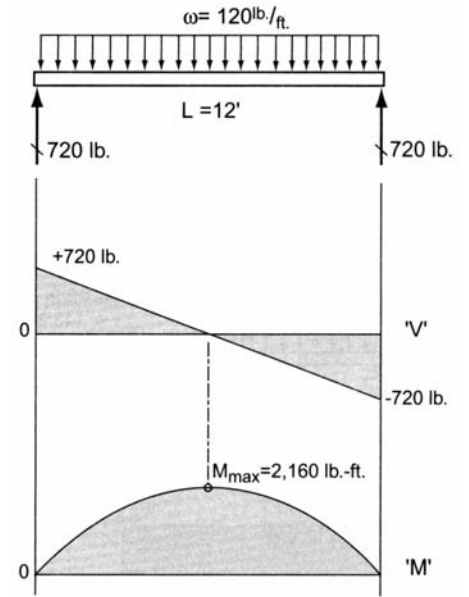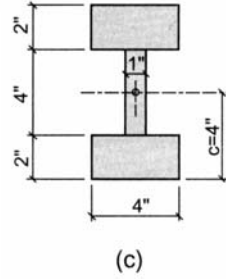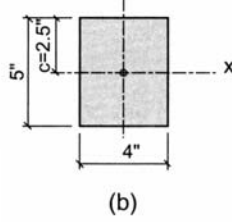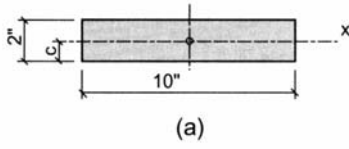


Example 2 (pg 309)

Example Problem 9.7 (Figures 9.31 to 9.33)


Design the roof and second-floor beams if $F_b = 1550$ psi (Southern pine No. 1).

- Roof: Snow +DL = 200 lb/ft
- Walls: 400 lb on 2nd floor beams
- Railing: 100 lb on beam overhang
- Second Floor: DL + LL = 300 lb/ft (including overhang)

Roof:

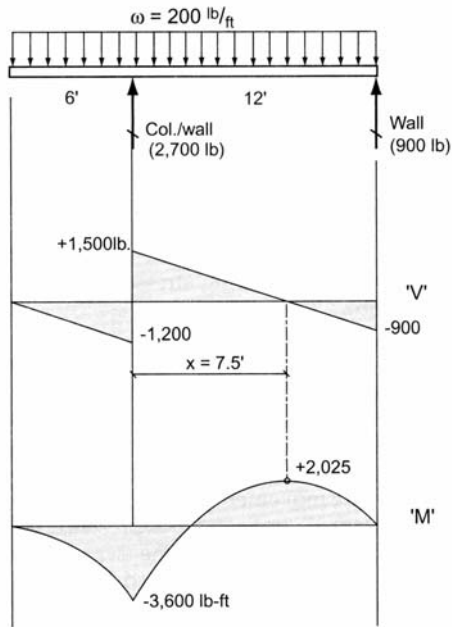

Second Floor:

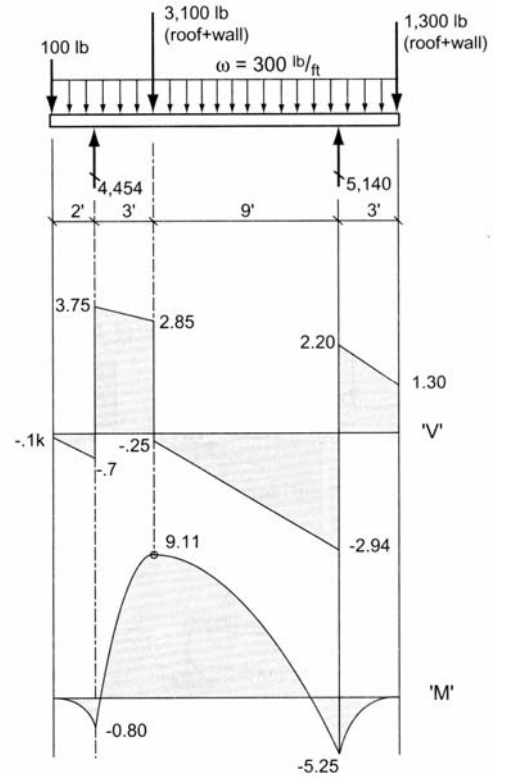

Example 3 (pg 313)




Example Problem 9.8: Shear Stress
(Figures 9.43 to 9.47)

Calculate the maximum bending and shear stress for the beam shown.

ALSO: Determine the minimum nail spacing required (pitch) if the shear capacity of a nail (F) is 250 lb.


Component	A (in. ²)	\bar{y} (in.)	$\bar{y}\Delta A$ (in. ³)
	12	7	84
	12	3	36

Component	I_{xc} (in. ⁴)	A (in. ²)	d_y (in.)	Ad_y^2 (in. ⁴)
	4	12	2	48
	36	12	2	48

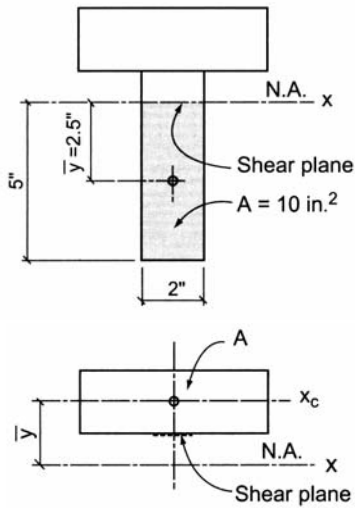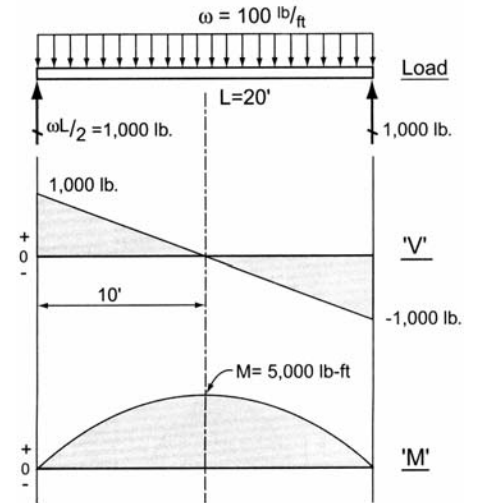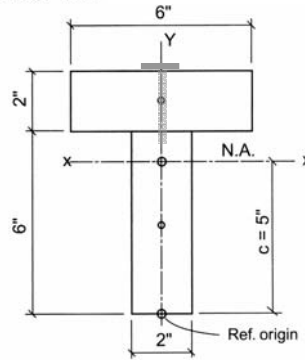

Example 4


8.11 A built-up plywood box beam with 2 x 4 S4S top and bottom flanges is held together by nails. Determine the pitch (spacing) of the nails if the beam supports a uniform load of 200 #/ft. along the 26-foot span. Assume the nails have a shear capacity of 80# each.

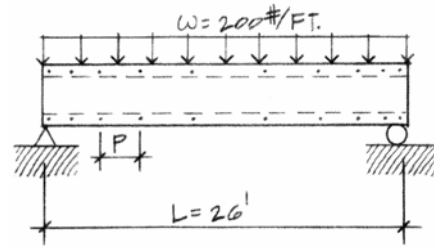

Solution:

Construct the shear (V) diagram to obtain the critical shear condition and its location

Note that the condition of shear is critical at the supports, and the shear intensity decreases as you approach the center line of the beam. This would indicate that the nail spacing P varies from the support to midspan. Nails are closely spaced at the support, but increasing spacing occurs toward midspan, following the shear diagram.

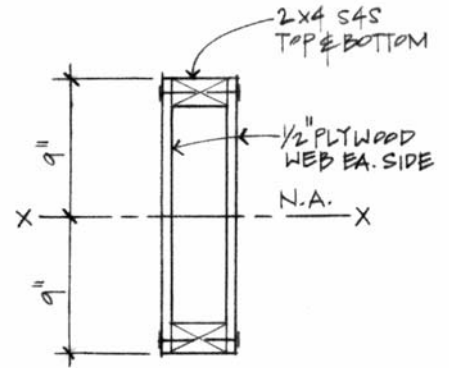

$$f_v = \frac{VQ}{Ib}$$

$$I_x = \frac{(4.5'')(18'')^3}{12} - \frac{(3.5'')(15'')^3}{12} = 1,202.6 \text{ in.}^4$$

$$Q = A\bar{y} = (5.25 \text{ in.}^2)(8.25'') = 43.3 \text{ in.}^3$$

$$\text{Shear force} = f_v \times A_v$$

where:





A_v = shear area

Assume:

F = Capacity of two nails (one each side) at the flange; representing two shear surfaces

$$(n)F = f_v \times b \times p = \frac{VQ}{Ib} \times bp$$

$$\therefore (n)F = p \times \frac{VQ}{I}; \quad p = \frac{(n)F I_x}{VQ}$$

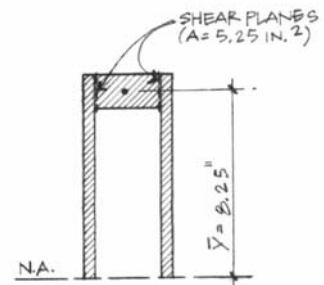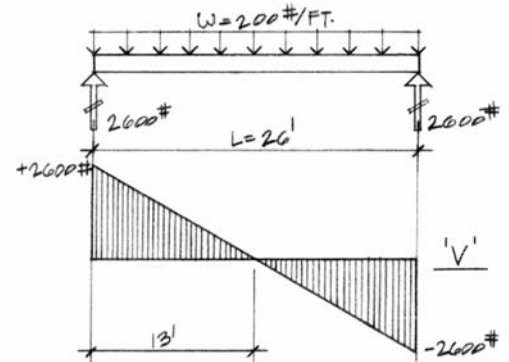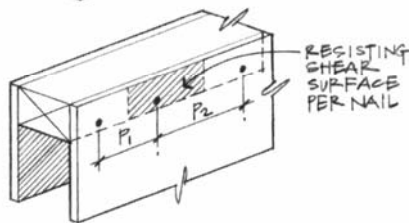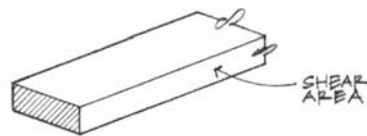

At the maximum shear location (support) where $V = 2,600\#$

$$p = \frac{(2 \text{ nails} \times 80 \text{ #/nail})(1,202.6 \text{ in.}^4)}{(2,600\#)(43.3 \text{ in.}^3)} = 1.71''$$